


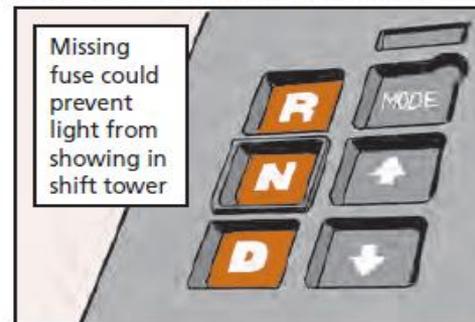

Does your unit have an M915A4 truck that won't start and has no light on the shift tower? Or does the shift selector in your M915A4 truck's cab no longer shift into drive? In both cases, the problem may be a missing fuse.

The factory mislabeled some of the M915A4's fuses as spares. They're not really spares because each one is needed for your truck to run right.

The solution is to keep *all* fuses installed in the fuse panel. Be sure there's a fuse in every empty slot. Then keep extra fuses in your glove compartment. You may need them later.



EYEBALL THIS TABLE FOR FUSE NSNS.

Size	NSN 5920-01-
10A	149-6952
15A	085-0825
20A	123-5211
25A	149-6953
30A	188-6294

