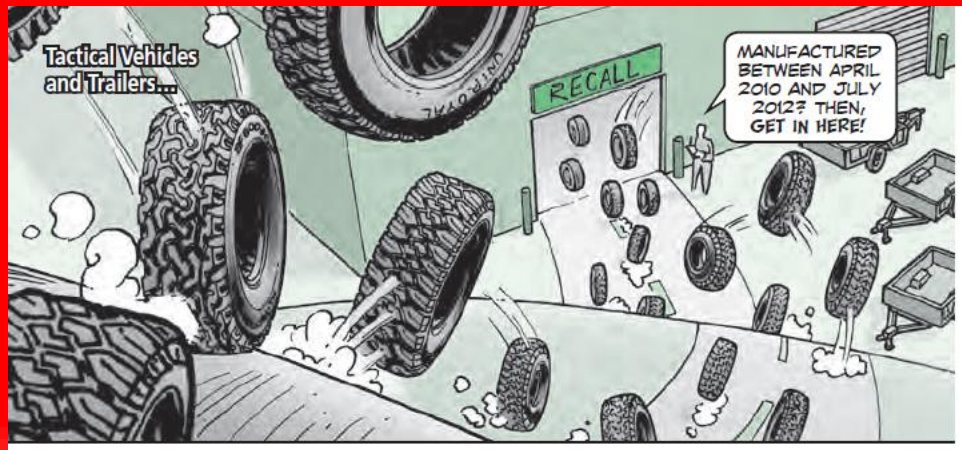

BF Goodrich® and Uniroyal® RECALL Tires

Have your vehicle's tires had tread loss or rapid air loss resulting from tread belt separation? That increases the risk of a crash! LT235/85R16 and LT245/75R16 tires that come with NSN 2610-01-148-1635 (BF Goodrich®) and NSN 2610-01-439-6224 (Uniroyal®) and were manufactured between April 2010 and July 2012 may fit this category.

These tires have been recalled, so check to see if you have them. You'll need to replace them. They belong on the M116A2 light cargo trailer, M101A2 cargo trailer, M1008 commercial utility cargo vehicle (CUCV), M1008A1 CUCV, M1010 CUCV, the CUCV ambulance, M1028 CUCV, M1028A1 CUCV, M1028A3 CUCV, M1031 CUCV and a variety of other commercial vehicles (light trucks, vans, ambulances) and light engineer equipment. The tires are either stocked in 65 SSAs throughout the Army, were originally supplied with the vehicle, or were supplied locally.

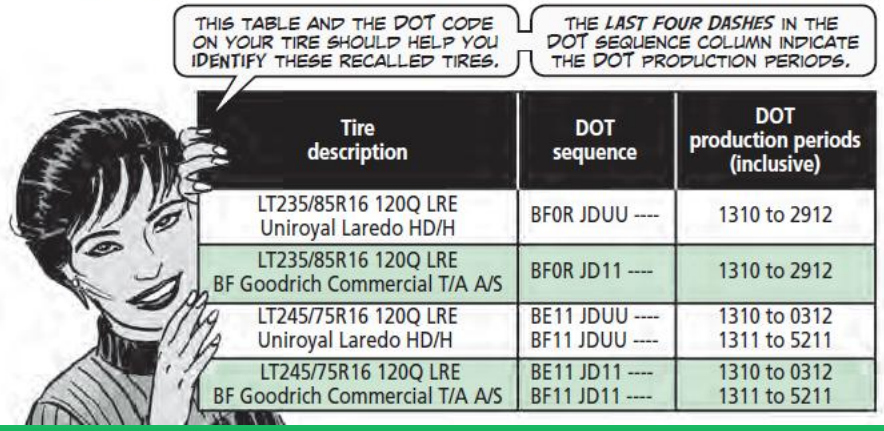

Tire description	DOT sequence	DOT production periods (inclusive)
LT235/85R16 120Q LRE Uniroyal Laredo HD/H	BF0R JDUU ----	1310 to 2912
LT235/85R16 120Q LRE BF Goodrich Commercial T/A A/S	BF0R JD11 ----	1310 to 2912
LT245/75R16 120Q LRE Uniroyal Laredo HD/H	BE11 JDUU ---- BF11 JDUU ----	1310 to 0312 1311 to 5211
LT245/75R16 120Q LRE BF Goodrich Commercial T/A A/S	BE11 JD11 ---- BF11 JD11 ----	1310 to 0312 1311 to 5211

Example of DOT Tire Code

Find DOT code on tire's sidewall and note last 4 digits of the date code indicating the 2 digit week and 2 digit year of production. 0402 means the 4th week of the year 2002

Department of Transportation — Tire size code — Date of manufacture

DOT NC M7 ABCD 0402

Manufacturer's plant code — Group of optional codes

CONUS users with recalled tires can do a one-for-one replacement at no charge through a Uniroyal® or BF Goodrich® dealer. Find the one closest to your unit by calling 1-800-637-5527. Or you can visit online locators:

http://www.uniroyaltires.com

or

http://www.bfgoodrichtires.com

No SDRs or PQDRs are needed.

OCONUS users should submit an SF-364, *Supply Discrepancy Report*. Demilitarize recalled tires by cutting the bead and submitting a completed DD Form 1348-1 to DLA's Disposition Services. **Respond by 31 Dec 2012.**

Questions? Contact DLA for assistance:

DSCC.TiresTeam@dla.mil

MRAP MEL Guidance

Need maintenance expenditure limit (MEL) guidance for inspecting battle and catastrophic damage to your Army MRAP vehicles? Take a look at TACOM maintenance action message 12-018: https://tulsa.tacom.army.mil/SAFETY/message.cfm?id=MA12-018.html The link to the MEL guidance document is inside this message. You'll need your CAC card to open this link.

PLS Service Kits

Get the annual service kit for the palletized loading system (PLS) with NSN 2590-01-539-6378. That kit also includes the semi-annual kit, NSN 2590-01-521-9985. Make a note until the kits are added to TM 9-2320-364-14&P in EM-0206, *IETM for M1074, M1075, M1076, and M1077 PLS* (Apr 09).

FMTV Door Seal

Get the door seal for the family of medium tactical vehicles with NSN 5330-01-568-0585. This NSN replaces the parts info shown as Item 2 in Fig 201 of TM 9-2320-365-24P and Item 2 in Fig 268 of TM 9-2320-366-24P.